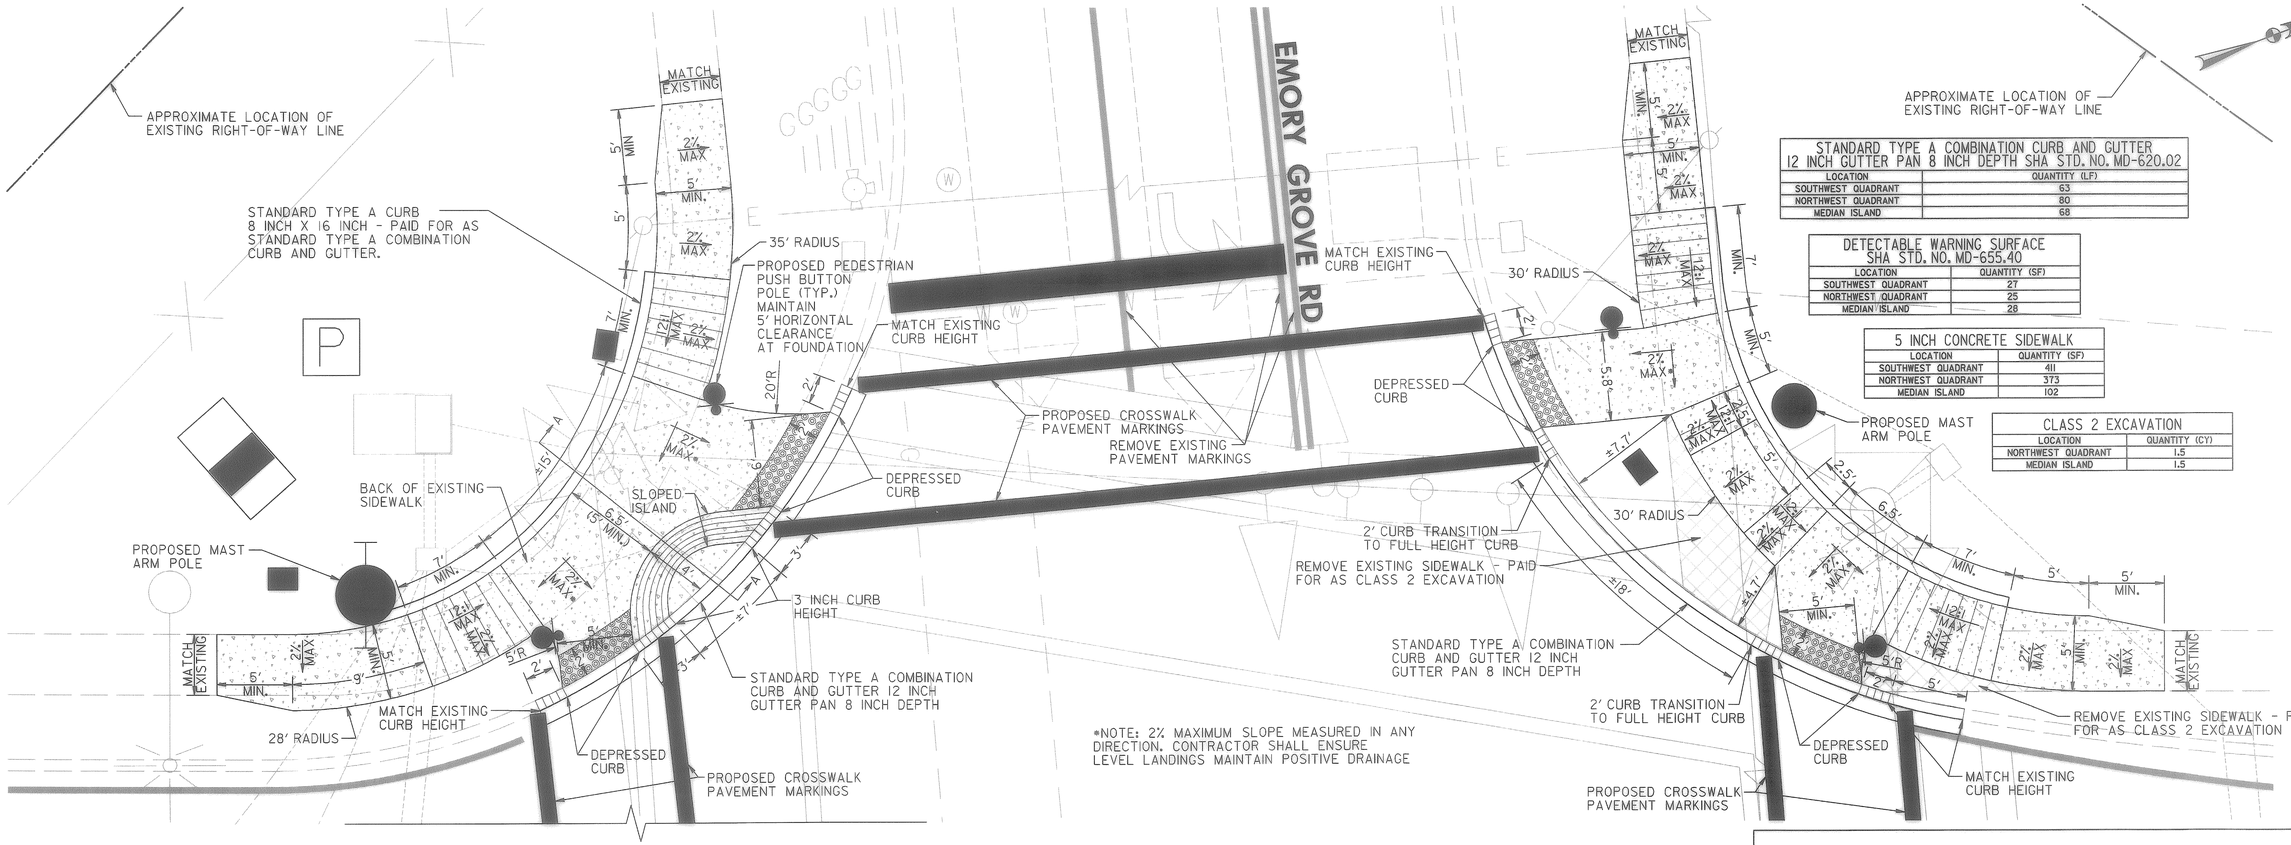

STANDARD TYPE A COMBINATION CURB AND GUTTER 12 INCH GUTTER PAN 8 INCH DEPTH SHA STD. NO. MD-620.02	
LOCATION	QUANTITY (LF)
SOUTHWEST QUADRANT	63
NORTHWEST QUADRANT	80
MEDIAN ISLAND	68

DETECTABLE WARNING SURFACE SHA STD. NO. MD-655.40	
LOCATION	QUANTITY (SF)
SOUTHWEST QUADRANT	27
NORTHWEST QUADRANT	25
MEDIAN ISLAND	28

5 INCH CONCRETE SIDEWALK	
LOCATION	QUANTITY (SF)
SOUTHWEST QUADRANT	411
NORTHWEST QUADRANT	373
MEDIAN ISLAND	102

CLASS 2 EXCAVATION	
LOCATION	QUANTITY (CY)
NORTHWEST QUADRANT	1.5
MEDIAN ISLAND	1.5

*NOTE: 2% MAXIMUM SLOPE MEASURED IN ANY DIRECTION. CONTRACTOR SHALL ENSURE LEVEL LANDINGS MAINTAIN POSITIVE DRAINAGE

MD 124 (WOODFIELD RD)

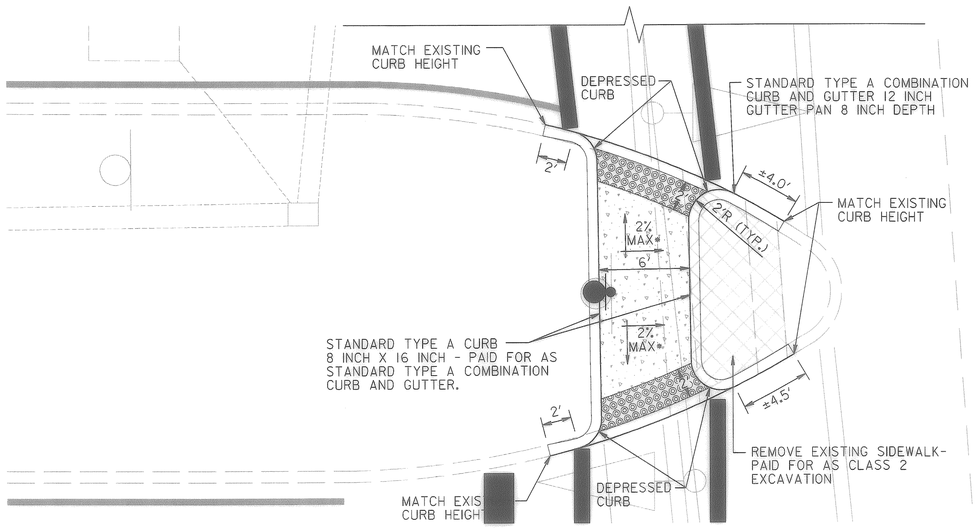

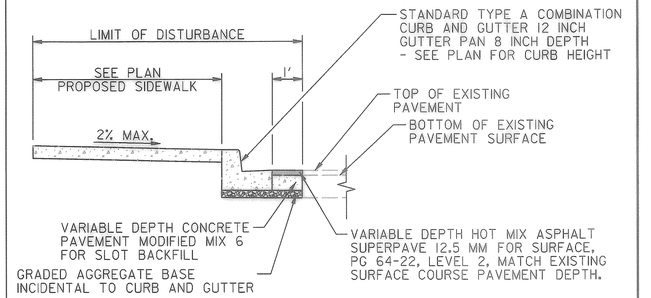

TYPICAL SECTION
PROPOSED SIDEWALK WITH CURB REPLACEMENT AND SLOT BACKFILL
NOT TO SCALE

GENERAL NOTES

1. FOR 5 INCH CONCRETE SIDEWALK RECONSTRUCTION, SEE TYPICAL SECTION, THIS SHEET. SEE SHEET DE-2 FOR SECTION A-A.
2. ALL DIMENSIONS ARE APPROXIMATE. CONTRACTOR TO VERIFY ALL DIMENSIONS IN THE FIELD.
3. NO DISTURBED AREA SHALL BE LEFT UNSTABILIZED OVERNIGHT UNLESS THE RUNOFF IS DIRECTED TO AN APPROVED SEDIMENT CONTROL DEVICE.
4. SIDEWALK RECONSTRUCTION LIMITS SHALL COINCIDE WITH CRACK CONTROL JOINTS (JOINTER GROOVES) OR EXPANSION JOINTS IN EXISTING SIDEWALK. NEW EXPANSION JOINTS SHALL BE PROVIDED AT THE INTERFACE OF EXISTING AND PROPOSED SIDEWALK. SEE SHA. STD. NO. MD-655.01.
5. INSTALL DETECTABLE WARNING SURFACE ON SIDEWALK RAMP AS PER SHA STD. NO. MD-655.40.
6. FORM NEW SIDEWALK AND EXPANSION JOINT MATERIAL AROUND EX. UTILITY POLES, MANHOLE COVERS, VALVE COVERS, AND FIRE HYDRANTS AS NECESSARY.
7. RESET ANY SIGNS DISTURBED BY THE CONSTRUCTION AS DIRECTED BY THE ENGINEER.
8. EXISTING INLETS SHALL NOT BE DAMAGED DURING CONSTRUCTION. DAMAGE TO THE INLETS WILL REQUIRE THE INLET TO BE REPLACED AT NO ADDITIONAL COST TO THE ADMINISTRATION.
9. EXISTING TREES, SHRUBS, AND THEIR RESPECTIVE ROOT SYSTEMS SHALL NOT BE DISTURBED DURING CONSTRUCTION.

LEGEND

- CONCRETE PAVEMENT
- DETECTABLE WARNING SURFACE SHA STD. NO. MD-655.40
- CLASS 2 EXCAVATION

TOD NO: XY224-18
SHA NO: MO145B56
MD 124 @ Emory Grove Road

RK&K
RUMMEL, KLEPPER & KAHL, LLP
81 MOSHER STREET | BALTIMORE, MD 21217
PH: (410) 728-2900 FAX: (410) 728-3160
Engineers | Construction Managers | Planners | Scientists
www.rkk.com

REVISIONS

STATE OF MARYLAND
DEPARTMENT OF TRANSPORTATION
STATE HIGHWAY ADMINISTRATION

MD 124 (WOODFIELD RD.) AT EMORY GROVE RD.

RAMP DETAILS

SCALE	1" = 5'	DATE	JUNE 2012
CONTRACT NO.	XY2245185		
DESIGNED BY	JDG	COUNTY	MONTGOMERY
DRAWN BY	JBB	LOGMILE	15012406.15
CHECKED BY	WRW	TIMS NO.	L172
FAP NO.		TOD NO.	

TS NO. 4366B-DE	DRAWING DE-1 OF 2	SHEET NO. 3 OF 4

PLOTTED: Friday, June 15, 2012 AT 01:46 PM
FILE: K:\projects\2008\08148_tcdides\Task 90_MD 124\CADD\Plans\pDE-0001_MD124@EmoryGrove.dgn

BY: jgolomb -